



SECTION H-H

CORNICE NO-1

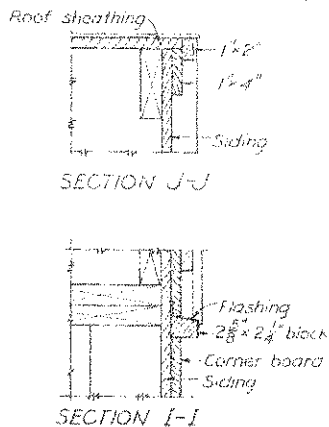


SECTION J-J

SECTION I-I

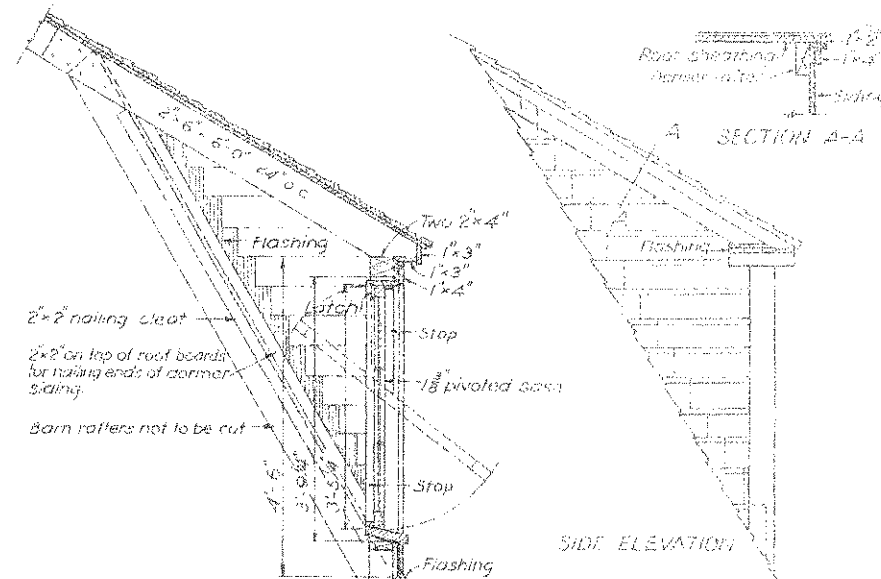


CROSS SECTION

SIDE ELEVATION

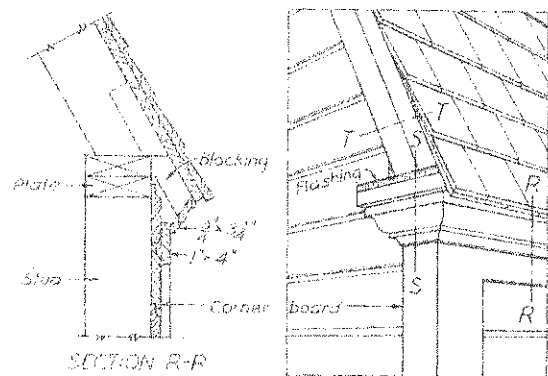


SECTION R-R

CORNICE NO-2

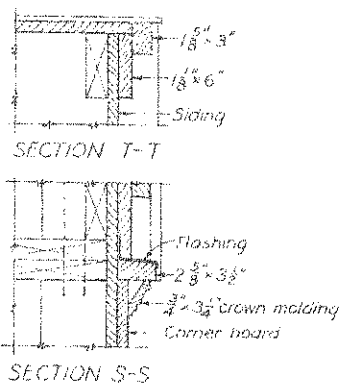

SECTION T-T


SECTION S-S

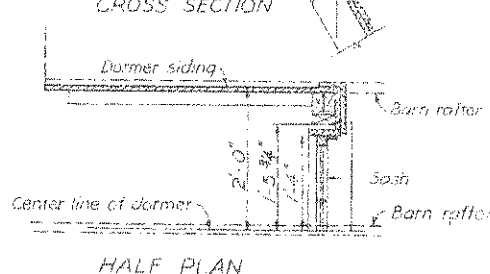


HALF PLAN

DORMER DETAILS

Scale 3/4" = 1'-0"

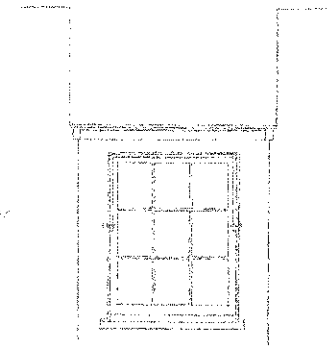


EXTERIOR ELEVATION  
Scale 1/2" = 1'-0"

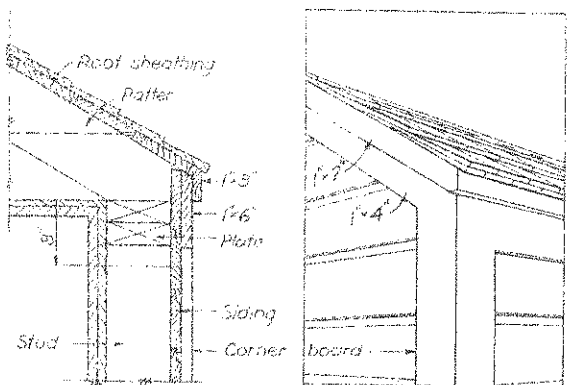


CORNICE NO-3

Scale 1/4" = 1'-0"

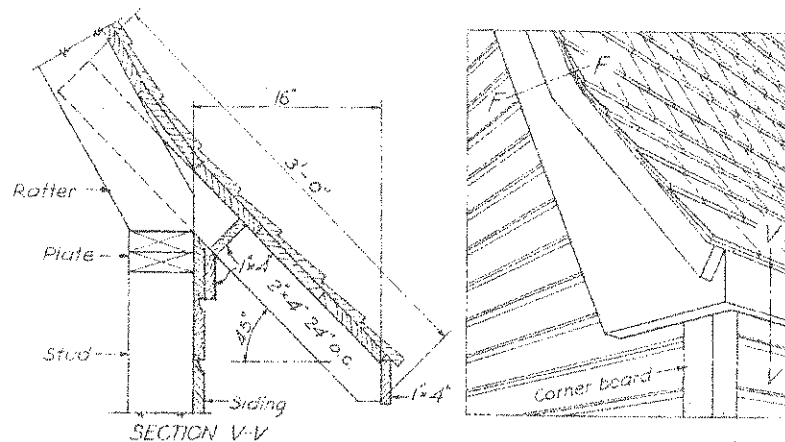

SECTION V-V

CORNICE NO-4

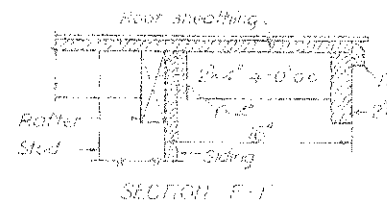

SECTION F-F

COOPERATIVE EXTENSION WORK IN AGRICULTURE AND HOME ECONOMY STATE OF NORTH DAKOTA NORTH DAKOTA AGRICULTURAL COLLEGE AND UNITED STATES DEPARTMENT OF AGRICULTURE (EM-107)		
BARN EAVES DETAILS		
USDA	EXL 2199	SHEET 1 OF 1