



NOTES:

1. CAUTION: CHECK WITH HEALTH AND MARKETING OFFICIALS FOR COMPLIANCE WITH MILKING PARLOR, AND MILK-ROOM/CHEESE PROCESSING PLANT RULES. REQUIREMENTS VARY FROM STATE TO STATE WITH REGARD TO SEPARATION OF ROOMS, VENTILATION, WINDOW AREA, AND INTERIOR FINISH
2. CHECK WITH ENVIRONMENTAL AUTHORITIES REGARDING WASTE HANDLING
3. COLD CLIMATES WILL REQUIRE INSULATED EXTERIOR WALLS
4. HEATING AND OTHER MECHANICAL EQUIPMENT TO BE LOCATED IN EQUIPMENT ROOM OR IN AN ADD-ON SHELTER OUTSIDE
5. AWNING WINDOWS RECOMMENDED TO AID IN SUMMER VENTILATION. ALL OPENINGS TO BE SCREENED.
6. IF PLATFORM IS FABRICATED OUTSIDE OF ROOM, CHECK DOOR CLEARANCE. ANCHOR PLATFORM TO WALLS AT EACH END.

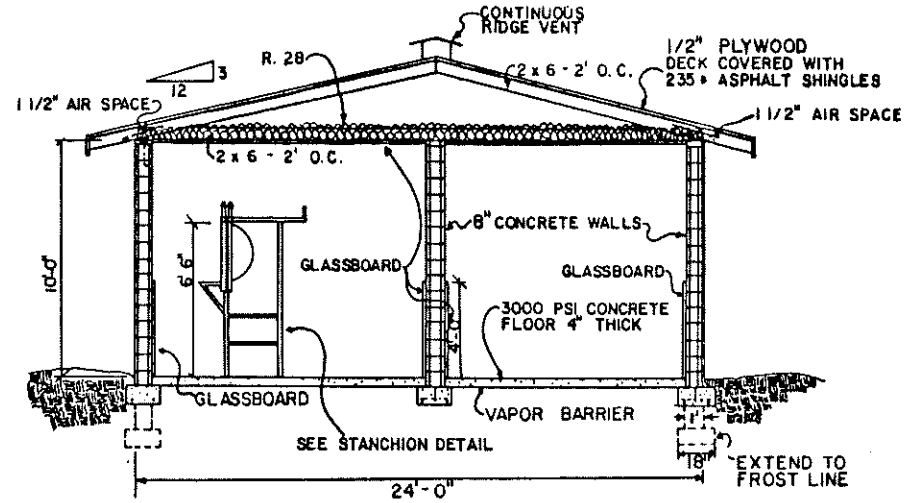


CROSS SECTION

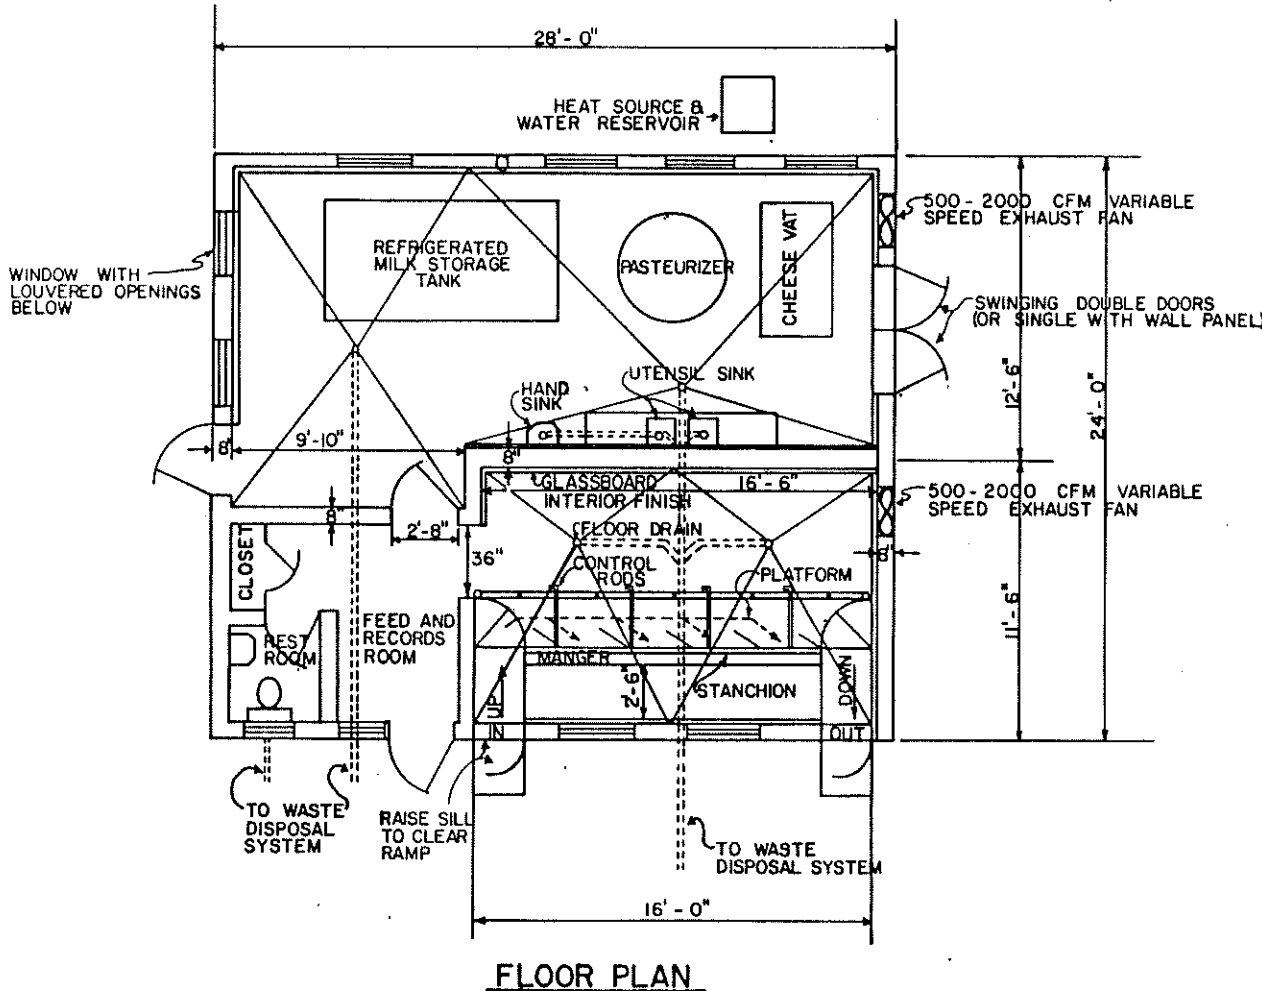


FLOOR PLAN


COOPERATIVE EXTENSION SERVICE AGRICULTURE AND HOME ECONOMICS		
AND UNITED STATES DEPARTMENT OF AGRICULTURE COOPERATING		
4 GOAT HERRINGBONE DAIRY PARLOR AND CHEESE PLANT		
GA '88	6405	SHEET 1 OF 2

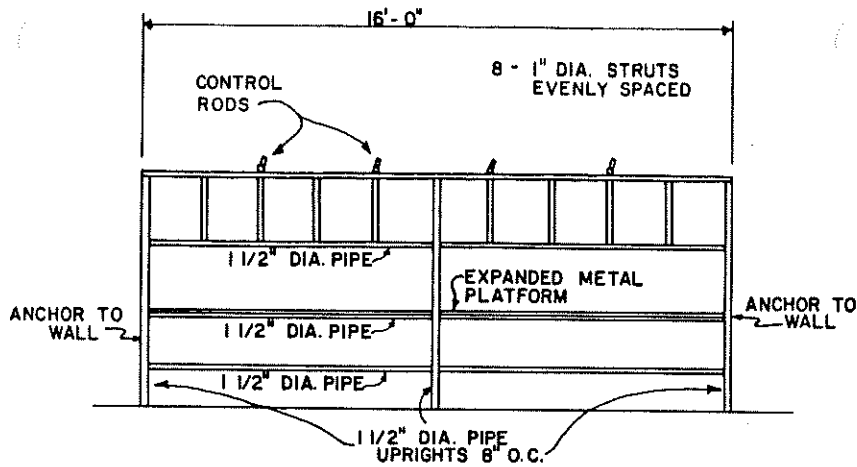


SUPPORT STRUCTURE (MILKING SIDE) AS VIEWED FROM MILKING SIDE

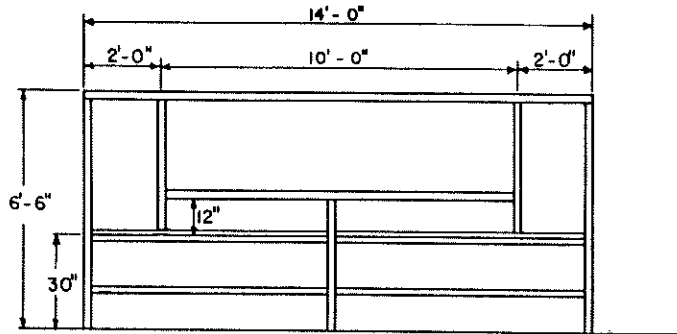

SUPPORT STRUCTURE (STANCHION SIDE) AS VIEWED FROM MILKING SIDE

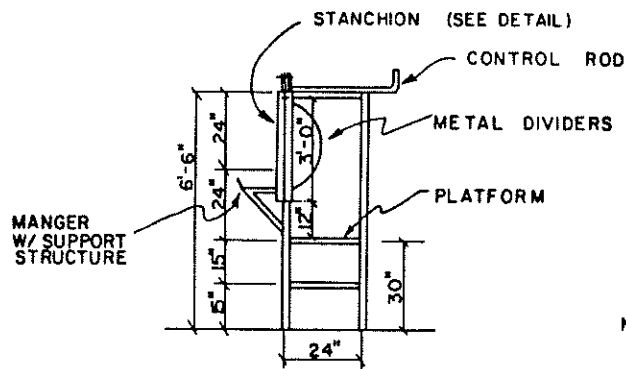


SIDE VIEW OF STANCHION

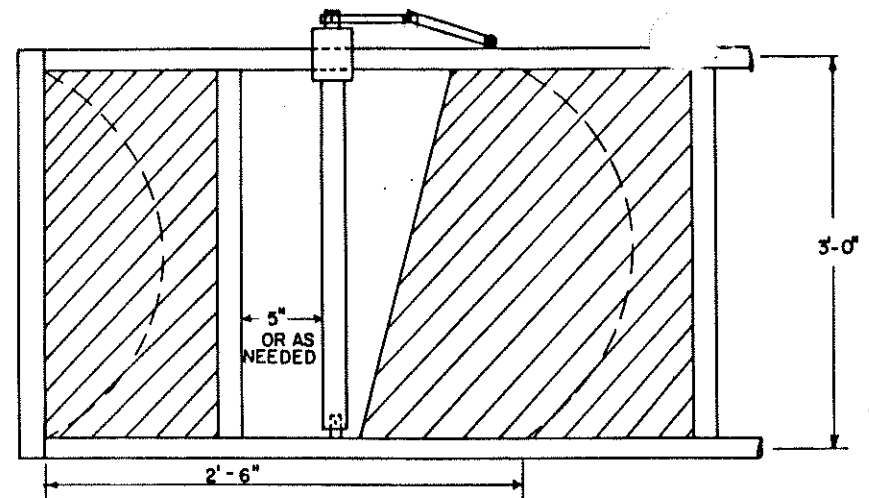

CLOSED

LOCKING STANCHION DETAIL (NO SCALE)

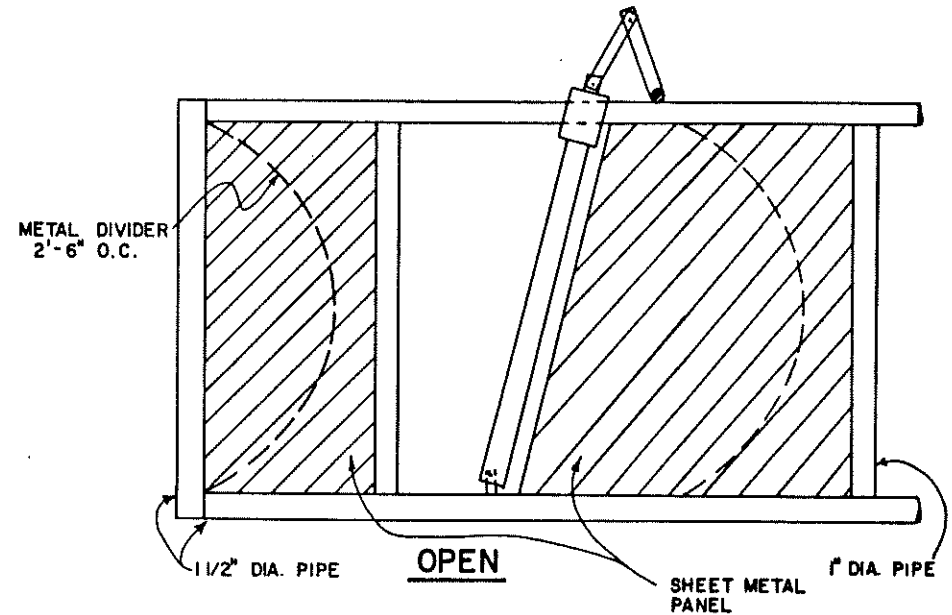

OPEN

NOTE: PLATFORM HEIGHT DIMENSION CAN BE CHANGED TO SUIT OPERATOR BUT 30" IS ABOUT MAXIMUM IF CONTROL ROD IS TO REMAIN WITHIN REACH.

COOPERATIVE EXTENSION SERVICE AGRICULTURE AND HOME ECONOMICS		
UNITED STATES DEPARTMENT OF AGRICULTURE COOPERATING		
4 GOAT HERRINGBONE DAIRY PARLOR AND CHEESE PLANT		
GA '88	6405	SHEET 2 OF 2